

**Supplementary information for "Low-loss silicon nitride Kerr-microresonators
fabricated with metallic etch masks via metal lift-off"**

Gabriel M. Colación, Lala Rukh, and Franco Buck

*Optical Science & Engineering Program, University of New Mexico, Albuquerque, NM 87106, USA and
Center for High Technology Materials, University of New Mexico, Albuquerque, NM 87106, USA*

Tara E. Drake

*Optical Science & Engineering Program, University of New Mexico, Albuquerque, NM 87106, USA
Center for High Technology Materials, University of New Mexico, Albuquerque, NM 87106, USA and
Department of Physics & Astronomy, University of New Mexico, Albuquerque, NM 87106, USA*

**I. REDEPOSITION, INCOMPLETE PATTERNING, AND EXCESS METAL BUILDUP:
CHARACTERISTIC ISSUES IN METAL LIFT-OFF AND THEIR SIGNATURES IN THE WAVEGUIDES**

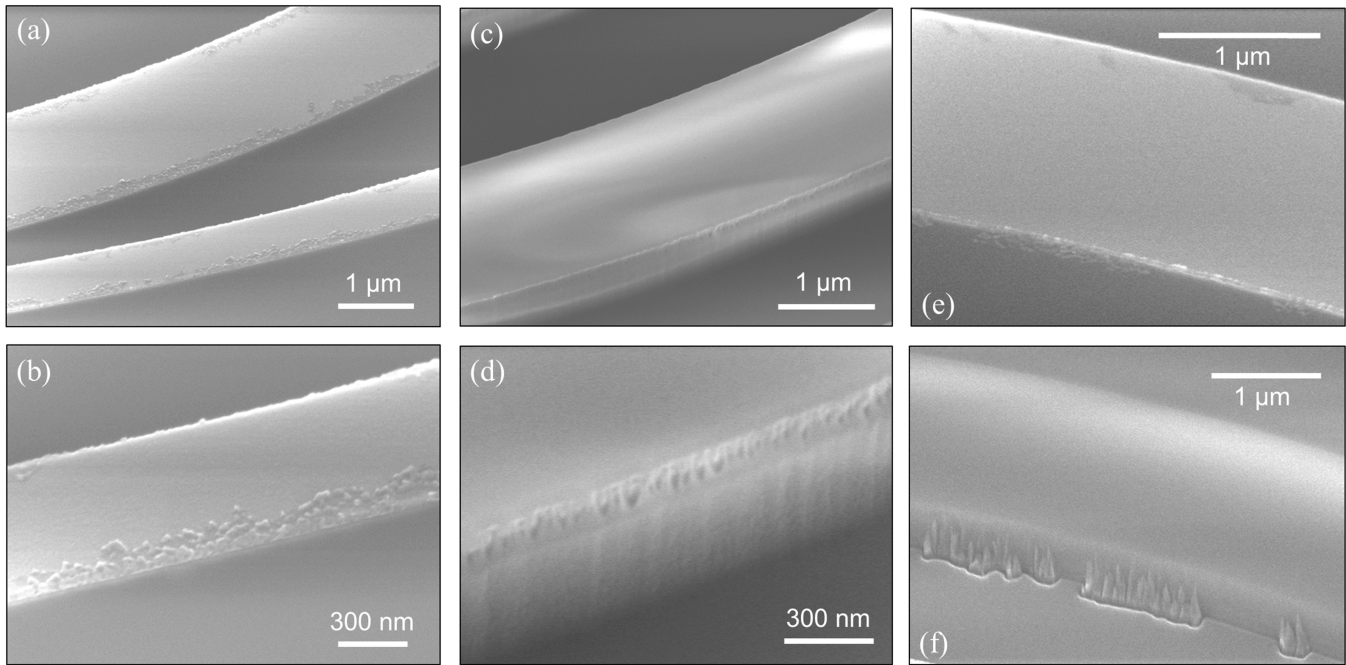


FIG. S1. SEM micrographs of lift-off defects and their effects post-etching. (a) SEM micrograph showing impartial lift-off with (b) zoomed focus on the extra metal and roughness along the perimeter of the metal mask. The metal mask is shown on the bare silicon nitride prior to etching. (c) SEM of etched ring resonator waveguide, prior to metal mask removal. (d) High magnification SEM of the sidewall in (c), showing roughness in the form of vertical striations transferred from the metal mask. (e) Lift-off defects extending past sidewall perimeter due to either impartial lift-off or metal re-deposition resulting in unwanted masking. The metal mask is shown on the bare silicon nitride prior to etching. (f) Partially etched "islands" due to the defect masking in (e).

While metal deposition and lift-off has the advantage of being a relatively simple addition to the subtractive fabrication flow, it introduces additional defect-prone steps that can carry flaws through to the final device in the subsequent etch. Aside from the quality of the metal layer (which determines the results in Fig. 6), metal deposition on the sacrificial resist sidewall, incomplete/partial lift-off, and re-deposition of the floated metal during lift-off are all potential pitfalls that must be considered and avoided. We highlight these three issues in Fig. S1. Partial lift-off due to sidewall deposition (Fig. S1a and S1b (zoomed)) can result in post-etch roughness transferred to the sidewall after etching, as seen in Fig. S1c and S1d (zoomed). In cases where the defects extend past the sidewall, or there is re-deposition of the lifted metal in the open areas (Fig. S1e), defects such as the partially etched "islands" along the waveguide sidewalls (seen in Fig. S1f) may be observed. For the issue of sidewall deposition resulting in poor mask edge quality and/or poor lift-off, targeting an "undercut" profile in the resist sidewall can aid in shielding the sidewall from unwanted metal deposition. If re-deposition in the subsequent lift-off stage is an issue, heating the solvent and/or performing the lift-off in an ultrasonic bath may help remove the lifted metal from the surface and away from the open area to be etched. We have found that SEM imaging can clearly identify the above defects associated with metal lift-off, providing a clear way to immediately identify workable devices.