Sameen Ahmed Khan Engineering Department Salalah College of Technology (SCOT) Post Box No. 608, Postal Code: 211 Salalah, Sultanate of Oman. rohelakhan@yahoo.com, http://SameenAhmedKhan.webs.com/

Abstract

Spherometer is an instrument widely used for measuring the radius of curvature of a spherical surface. Cylindrometer is a modified spherometer, which can measure the radii of both spherical and cylindrical surfaces. Both of these instruments are based on a geometric relation unique to circles and spheres, from Euclidean geometry. A more general understanding is obtained using coordinate geometry. The coordinate geometric approach also enables a generalization of the spherometer and cylindrometer to devices, which can handle aspherical surfaces. Here, we present the newly developed coordinate geometric approach and its applications.

Keywords and phrases: Spherometer, Ball-Spherometer, Ring-Spherometer, Cylindrometer, Cylindro-Spherometer, Sphero-Cylindrometer, Ball-Cylindrometer, Quadricmeter, Coordinate Representation, Aspherical Surfaces, Quadratic Surfaces, Optical Techniques, Radius of Curvature.

PACS: 06.30.Bp; 07.60.-j; 42.86.+b; 02.40.-k

OCIS: 000.3860; 220.4610.

Subj-class: MP-Mathematical Physics

Mathematics Subject Classification: 14Q10, 51N20

Contents

1	Introduction	3
2	Spherometer: the Traditional Approach	5
3	Spherometer: A Coordinate Geometric Representation	8
4	Cylindrometer: A Coordinate Geometric Representation	11
5	Concluding Remarks	13
$\mathbf{A}_{]}$	ppendix A. Ball-Spherometer	14
$\mathbf{A}_{]}$	ppendix B. Ring-Spherometer	15
$\mathbf{A}_{]}$	ppendix C. Cylindrometer	16
$\mathbf{A}_{]}$	ppendix D. Aspherical Surfaces	19
$\mathbf{A}_{]}$	ppendix E. Quadratic Surfaces E.1.1Classification of Quadratic Surfaces E.1.2Quadratic Surfaces of Revolution	20 21 23
$\mathbf{A}_{]}$	ppendix F. Quadricmeter	25
\mathbf{A}_{j}	ppendix G. Optical Techniques	26
$\mathbf{A}_{]}$	ppendix H. Radius of Curvature	27
Bi	bliography	27

List of Figures

1	The Common Spherometer.	4
2	The Geometry of the Spherometer.	6
3	A Coordinate Representation of the Spherometer.	9
4	A Coordinate Representation of the Cylindrometer	
5	The Ball-Spherometer fabricated by the author	
6	The Ring-Spherometer fabricated by the author.	
7	The Cylindrometer fabricated by the author.	
8	The Ball-Cylindrometer fabricated by the author	

2

1 Introduction

Spherometers are precision instruments designed to measure the radius of curvature of spherical surfaces as the name suggests. They are particularly useful for situations, where only a portion of the spherical surface is available. Such situations are very common in the optics workshops, while fabricating lenses and mirrors [1]-[9]. They were designed by the opticians of the early-nineteenth century (or even earlier).

Although there is some thought that the spherometer was invented by the French optician Laroue, the first spherometer of which there is positive knowledge was devised and named around 1810 by Robert-Aglaé Cauchoix, and made by the French mechanician Nicolas Fortin. Cauchoix's design, a three-legged base supporting a central micrometer screw, was quickly adopted as the basic standard and remains in use to this day. The Conservatorie National des Arts et Metiers in Paris has a spherometer made by Cauchoix and used by Biot that reads to 1/1000 millimeter [10].

Figure-1 has the very widely used tripod design. If the radii of both surfaces of the lens and the index of refraction of the lens material are known, the focal length can be found using the Lens-Maker's equation [11].

$$P = \frac{1}{f} = (\mu - 1) \left[\frac{1}{R_1} - \frac{1}{R_2} + \frac{(\mu - 1)d}{\mu R_1 R_2} \right],$$
(1)

where P is the power of the lens, f is the focal length of the lens, μ is the refractive index of the lens material, R_1 and R_2 are the radii of curvature of the lens surfaces and d is the thickness of the lens. In the thin lens approximation, we have

$$P = \frac{1}{f} \approx (\mu - 1) \left[\frac{1}{R_1} - \frac{1}{R_2} \right] \,. \tag{2}$$

The error arising from the deviations from the tripod design have been also studied [12].

Many a time one is dealing with aspherical surfaces (non-spherical surfaces). For instance one may be dealing with cylindrical lenses or paraboloidal reflectors [13]. The study of elliptic and hyperbolic mirrors dates back to the time of Greeks [14] and the medieval Arabs. A comprehensive account of

Sameen Ahmed Khan



Figure 1: The Common Spherometer.

the *Medieval Arab contributions to optics* can be found in [15]-[35]. The beginning of the analogy between geometrical optics and mechanics, usually attributed to Descartes, can be traced to Abu Ali al-Hasan ibn al-Haytham (965-1039, known as Alhacen/Alhazen, the Latin transliteration of his first name al-Hasan, see [36]-[42] for details).

The occurrence of the aspherical surfaces in the optics workplace necessitate devices beyond the common spherometer. One of the earliest modifications can be traced back to 1924 (see [43] for the details). A prime example of such a modification is the device, cylindrometer which is also known as the *Cylindro-Spherometer* and *Sphero-Cylindrometer*. The cylindrometer can additionally measure the radius of curvature of a right-circular cylinder [44]-[46]. It is to be noted that the cylindrometer can not distinguish between spherical and cylindrical surfaces. Its usage requires one to assume that the surface under study is either spherical or cylindrical! It is further to be noted that the design of both the spherometer and the cylindrometer are based on

a geometric relation unique to circles and spheres, known since the times of Euclid [14].

In this article, we present an alternate approach using coordinate geometry in place of the Euclidean geometry. This provides us the familiar result for the spherometer. The coordinate geometric approach to the spherometer was developed recently [47]. This approach, using the powerful techniques of coordinate geometry is suitable to a generalization of the traditional spherometer to devices, which can characterize aspherical surfaces [48]. Section-2 has a review of the traditional derivation of the spherometer formula. Section-3 has a comprehensive account of the coordinate geometric approach to the spherometer. In section-4 the coordinate geometric approach is extended to the cylindrometer. In the Appendices, we shall describe the variants and modifications of the common spherometer. We shall also consider other geometries such as regular polygons and the ring geometry. Appendix-A covers the ballspherometer, which safeguards the surfaces under study from the sharp tips of the spherometer legs. Appendix-B describes the ring-spherometer. Both of these appendices contain images of the instruments fabricated by the author. Appendix-C describes the cylindrometer which can be used to measure the radius of curvature of both spherical and cylindrical surfaces. This appendix also covers the *ball-cylindrometer* fabricated by the author. Appendix-D has a note on the aspherical surfaces. Appendix-E is dedicated to the class of surfaces known as the quadratic surfaces. Appendix-F contains the abstract of the *quadricmeter* invented by the author. This device can completely characterize the quadratic surfaces. The spherometer, cylindrometer and the quadricmeter are contact devices. Appendix-G is dedicated to optical techniques used to characterize surfaces. Appendix-H has a short note on the radius of curvature with a mathematical perspective.

2 Spherometer: the Traditional Approach

Since the beginning the spherometers consist of a tripod framework supported on three fixed legs of equal lengths. Ideally the tips of the three legs form an equilateral triangle. The deviations from the ideal equilateral triangular geometry shall be discussed at the end of this section. A precisely cut micrometer-screw is made to pass through a nut fixed at the centroid of the equilateral triangle. The movable micrometer-screw and the three fixed legs should all be parallel to each other. The spherometer has two scales. One is the common millimeter scale, attached vertically to the tripod frame such that it is parallel to the axis o the micrometer-screw. The second scale is a large circular disc (with typically a hundred divisions), which is attached to the top of the micrometer-screw. The two scales together, working on the principle of the *screw gauge* provide an accurate measurement of the relative height of the tip of the micrometer-screw with respect to the plane containing the tips of the three fixed legs. This height of the micrometer-screw is known as *sagitta*. Accuracy requires the tips to be as sharp as possible.

Let the spherometer be placed on any spherical surface of radius of curvature R. The great circle of radius R touches the tip of the micrometer-screw, which has a relative height h with respect to the plane containing the (equilateral) triangle formed by the tips of the three fixed legs. Let L be the side of the equilateral triangle.

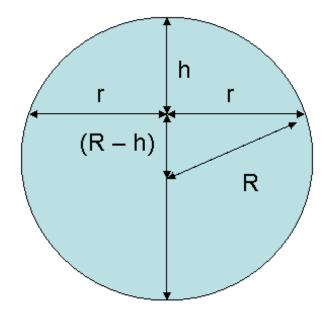


Figure 2: The Geometry of the Spherometer.

In Figure-2, we apply the Pythagorean theorem to the triangle and obtain the relation

$$r^{2} = R^{2} - (R - h)^{2} = h(2R - h).$$
(3)

This relation is central to the derivation of the spherometer formula. In fact

such a relation exists for any two chords (which need not be perpendicular, as shown in the figure-2), making circle unique with respect to the other conic sections. Equation (3) leads to the following equivalent relations

$$R(h) = \frac{r^2}{2h} + \frac{h}{2},$$

$$h(r) = R - \sqrt{R^2 - r^2} = \frac{r^2}{R + \sqrt{R^2 - r^2}}.$$
(4)

The radius, r of the circumcircle and the length, L of the equilateral triangle obey the relation $r = L/\sqrt{3}$. So, the radius of the sphere is given by

$$R(h) = \frac{L^2}{6h} + \frac{h}{2},$$
(5)

where h is the only measurable variable and L is a device constant. For a given instrument, the smallest measurable radius of curvature is $R_{\min} = R(h = L/\sqrt{3}) = r = L/\sqrt{3}$, which is at $h = r = L/\sqrt{3}$. The largest radius of curvature is constrained by the least count of the micrometer-screw (typically 0.01mm or better). The side L of the spherometer is several centimeters or more depending on the size of spherical surface to be studied. The size of a spherometer depends on the application. To measure just the sagitta at the centre of a mirror, one requires a spherometer with a base almost as big as the mirror itself. Using a smaller base one can move around the spherometer to detect local high and low spots produced during the fabrication.

Since the spherometer is essentially a type of micrometer, it can be employed for purposes other than measuring the curvature of a spherical surface. For example, it can be used to measure the thickness of a thin plate. To do so, the instrument is placed on a level plane surface and the screw turned until the point just touches it. Scales are read; screw is raised; the thin plate slipped under it; and the process is repeated. The difference between the two readings gives the required thickness.

During constructions there can be deviations from the ideal equilateral triangle geometry. When the lengths of the sides of the triangle are L_1 , L_2 and L_3 respectively, the radius r of the circumcircle is given by

$$r = \frac{L_1 L_2 L_3}{4\sqrt{s(s - L_1)(s - L_2)(s - L_3)}},$$
(6)

where $s = (L_1 + L_2 + L_3)/2$ is the semi-perimeter of the triangle. Using the relation (6), we obtain

$$R = \frac{L_1^2 L_2^2 L_3^2}{32hs(s - L_1)(s - L_2)(s - L_3)} + \frac{h}{2}.$$
 (7)

The formula in (7) generalizes the formula for the equilateral triangle in (5) and is due to Trikha and Bhatia (see [12] for the details).

The derivation, though elegant explicitly depends on two facts: firstly that the plane-sections of a sphere are always circles and secondly the geometric relation in (3). It is well known that the plane-sections of aspherical surfaces are in general not circles, but some other curves such as conic sections (ellipse, parabola and hyperbola). Moreover the corresponding geometric relations do not exist for conic sections. Analogous relations do exist for ellipse, parabola and hyperbola but work only at a single point, the vertex with h aligned to the axis of each conic respectively. Thus any attempt to design a spherometer-type device, based on the geometric relations would work only at one point, whose location would of course not be known a priory. So, it is natural to look beyond the geometric relations. The coordinate geometry provides a very natural choice [47].

3 Spherometer: A Coordinate Geometric Representation

In the framework of the coordinate geometry, any geometric figure is specified by a certain number of points on it. For instance, a sphere is uniquely determined by specifying four points on it. The four points are of course not coplanar [49]. The situation in the spherometer is precisely the same! The three points are the tips of the fixed legs forming the equilateral triangle and the fourth point is the tip of the movable micrometer-screw. This forms the basis of the coordinate geometric approach to the spherometer. The coordinate geometric representation of a sphere is not unique. A possible representation is as follows. We choose the plane of the equilateral triangle to lie completely in the X-Y plane, without any loss of generality. Then the tip of the micrometer-screw moves parallel to the Z-axis. Figure-3 has the details of the coordinate geometric representation.

The choice of our coordinate geometric representation is such that when the spherometer is placed on any plane surface, the z-coordinates of all the

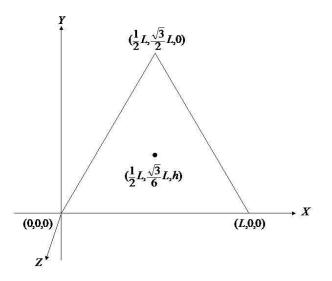


Figure 3: A Coordinate Representation of the Spherometer.

four points are identically zero. This is called as the *ground state* of the spherometer. This representation is such that, when the spherometer is placed on any spherical surface, only the z-coordinate of the micrometer-screw acquires the non-zero value of h; the remaining three corresponding to the three fixed legs remain unchanged from the value zero.

The most general equation of a sphere of radius R and centre at the point (α, β, γ) is

$$(x - \alpha)^{2} + (y - \beta)^{2} + (z - \gamma)^{2} = R^{2}.$$
(8)

The aforementioned equation has four unknown constants (including the radius, R), which can be uniquely determined by specifying four points on the sphere. Let us recall that the four points can not be coplanar. In our choice of the coordinate representation, using the coordinates of the tips of the three fixed legs, we readily obtain, $\alpha = L/2$, $\beta = (\sqrt{3}/6)L$, $\gamma^2 = R^2 - L^2/3$ and $\alpha^2 + \beta^2 + \gamma^2 = R^2$. The coordinates of the movable tip of the micrometerscrew lead decisively to $\gamma = L^2/6h - h/2$. Using these values of the four constants, the radius R of the spherical surface is obtained after straightforward substitution

$$R = \sqrt{\alpha^2 + \beta^2 + \gamma^2} = \pm \left(\frac{L^2}{6h} + \frac{h}{2}\right). \tag{9}$$

The *positive* and *negative* signs are for the *convex* and *concave* surfaces respectively.

The technique of the coordinate geometry has enabled us to understand the working of the spherometer in an entirely different manner. The traditional approach is based on a geometric relation unique to circles and spheres. The newly developed coordinate geometric approach is independent of any such explicit geometric relations. The choice of the coordinate representation ensures that the sphere is completely characterized by a single parameter, that is the height of the movable micrometer-screw. There are several advantages of using the coordinate geometric approach. It is capable of handling any changes, which may arise during the fabrication of the spherometer or during the measurements. Such changes are not uncommon, particularly when the spherometer is large, then it can deviate from its equilateral triangle geometry. In such a situation, it would suffice to revise the ground state of the spherometer, even at the final stages while the measurements are being made. The greater advantage of using the coordinate geometric approach is that it provides a better understanding of the spherometer design and further paves the way to modify and extend the tripod spherometer to devices which can handle surfaces which need not be spherical. Let us recall that the aspherical surfaces do not have the required geometric relations available for circles and spheres.

The equation of the sphere in terms of the four points lying on it can be expressed in the form of the following determinant equation (see [49]-[52] for details).

$$\begin{vmatrix} x^{2} + y^{2} + z^{2} & x & y & z & 1 \\ x_{1}^{2} + y_{1}^{2} + z_{1}^{2} & x_{1} & y_{1} & z_{1} & 1 \\ x_{2}^{2} + y_{2}^{2} + z_{2}^{2} & x_{2} & y_{2} & z_{2} & 1 \\ x_{3}^{2} + y_{3}^{2} + z_{3}^{2} & x_{3} & y_{3} & z_{3} & 1 \\ x_{4}^{2} + y_{4}^{2} + z_{4}^{2} & x_{4} & y_{4} & z_{4} & 1 \end{vmatrix} = 0.$$

$$(10)$$

For the common spherometer with an equilateral triangle base, and our choice of the coordinate representation in Figure-3, the determinant equation in (10) translates to

$$\begin{vmatrix} x^{2} + y^{2} + z^{2} & x & y & z & 1 \\ 0 & 0 & 0 & 0 & 1 \\ L^{2} & L & 0 & 0 & 1 \\ L^{2} & \frac{1}{2}L & \frac{\sqrt{3}}{2}L & 0 & 1 \\ \frac{1}{3}L^{2} + h^{2} & \frac{1}{2}L & \frac{\sqrt{3}}{6}L & h & 1 \end{vmatrix} = 0.$$
 (11)

The above equation can be solved to describe the sphere completely. One may use MS EXCEL [53]-[57] or a versatile symbolic package such as the MATHEMATICA incorporating the graphic environment [58, 59].

4 Cylindrometer: A Coordinate Geometric Representation

The traditional approach to the cylindrometer is described in detail in Appendix-C. The coordinate geometric approach to the cylindrometer is very similar to the one for the spherometer.

A right-circular cylinder is uniquely determined by specifying five points on it [49]. This is precisely the situation in a cylindrometer: the four points are the fixed tips of the square-base and the fifth point is the movable tip of the micrometer-screw. The coordinate geometric representation of a cylinder is not unique and we have chosen the following representation, which is the simplest. The tips of the four fixed legs lying on the corners of the square of side L can be chosen to lie completely in the X-Y plane, without any loss of generality. The tip of the micrometer-screw (lying at the centre of the square) moves parallel to the Z-axis. Figure-4 has the required details.

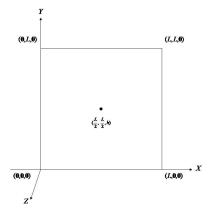


Figure 4: A Coordinate Representation of the Cylindrometer.

In this choice of representation, when the cylindrometer is placed on a plane surface, the z-coordinates of all the five points are identically zero. We

call this as the *ground state* of the cylindrometer. When the cylindrometer is placed on a cylindrical surface or a spherical surface, only the z-coordinate of the micrometer-screw changes to h and the remaining four points remain unchanged from the value zero.

The general equation of a right-circular cylinder of radius R and whose axis is the line $(x - \alpha)/l = (y - \beta)/m = (z - \gamma)/n$ is

$$(x-\alpha)^2 + (y-\beta)^2 + (z-\gamma)^2 - \frac{[l(x-\alpha) + m(y-\beta) + n(z-\gamma)]^2}{l^2 + m^2 + n^2} = R^2.$$
(12)

It is to be noted that the square base ensures that one pair of opposite sides of the square base are parallel to the axis of the cylinder and the other pair is perpendicular. This aspect helps us in simplifying the general equation of the cylinder. Without any loss of generality let us assume that the axis of the cylinder is parallel to the X-axis. Then, we have l = 1 and m = 0 = n. This reduces the general equation to $(y - \beta)^2 + (z - \gamma)^2 = R^2$. We handle this equation in a manner very similar to the spherometer and obtain

$$R_{\rm cylinder} = \pm \left(\frac{L^2}{8h} + \frac{h}{2}\right) \,. \tag{13}$$

Now, we place the cylindrometer on a sphere. Incorporating the coordinates of the tips of the four fixed legs in the equation of the sphere in (8) lead to $\alpha = \beta = L/2$ and $\gamma^2 = R^2 - L^2/2$. The coordinates of the movable tip of the micrometer-screw lead decisively to $\gamma = h \mp R$. Eliminating γ , we readily obtain

$$R_{\rm sphere} = \pm \left(\frac{L^2}{4h} + \frac{h}{2}\right) \,. \tag{14}$$

The *positive* and *negative* signs in (13) and (14) are for the convex and concave surfaces respectively.

Thus, we reproduce the familiar result using coordinate geometry. The choice of the coordinate representation ensures that the equation of the cylinder is dependent only on one measurable parameter, namely the height h of the screw. The sphere and the right-circular cylinder are the only geometries, which can be handled using the cylindrometer. Even a spheroid (ellipsoid of revolution) and the right-circular cone can not be handled using a cylindrometer. This dictates the need to have newer instruments which can handle the other geometries.

5 Concluding Remarks

We have reviewed the common spherometer and its modified avatars such as the ring-spherometer and the ball-spherometer. We have also reviewed the lesser known cylindrometer and seen how it can be used to measure the radii of curvature of both right-circular cylindrical surfaces and spherical surfaces [45, 46]. The idea of the *ball-spherometer* has been extended to the cylindrometer resulting in a *ball-cylindrometer* (Appendices A and C have the details along with the images). It is essential to look beyond and generalize the common spherometer and the cylindrometer to devices, which can enable the study of a wider range of surfaces occurring in science and engineering [48]. Coordinate geometry provides a natural framework for creation of such devices [47].

In coordinate geometry, a given figure is uniquely determined by specifying a certain number of points on it. This number varies from figure to figure. For instance, a sphere is completely characterized by its radius and the four points lying on it are sufficient to fix its radius. This demands the spherometer to be a four-point device. Hence its design has four points: the three points are the tips of the three fixed legs and the fourth point is the tip of the movable micrometer-screw. The choice of the coordinate representation ensures that there is only one variable parameter, h corresponding to the radius R of the sphere. A right-circular cylinder is characterized by its radius (the length of the cylinder is not under discussion in the present context). which can be fixed by five points on it. Cylindrical symmetry permits points to be coplanar. Hence, the cylindrometer is a five-point device. A judicious choice of the coordinate representation ensures that, we are again able to express the radius R of the cylindrical surface in terms of a single device variable, which is again the height of the movable tip of the micrometerscrew of the cylindrometer. A quadratic surface is described by the general second-order equation, which has nine independent constants [48, 51]. The nine points (no four points being coplanar) uniquely determine the quadratic surface. So, we require a nine point device to identify and completely characterize any quadratic surface. The four-point coordinate representation of a spherometer and the five-point coordinate representation of a cylindrometer, has been generalized to a nine-point device, the quadricmeter, which generates the equation of the quadratic surfaces in terms of measurable laboratory parameters [60, 61]. The quadricmeter is the instrument devised to identify, distinguish and measure the various parameters (including the axis, foci, latera recta, directrix) completely characterizing the important class of surfaces known as the quadratic surfaces. Quadratic surfaces (also known as quadrics and conicoids) include a wide range of commonly encountered surfaces including, cone, cylinder, ellipsoid, elliptic cone, elliptic cylinder, elliptic hyperboloid, elliptic paraboloid, hyperbolic cylinder, hyperbolic paraboloid, paraboloid, sphere, and spheroid. The complete characterization is done using the standard techniques of coordinate geometry. With a conventional spherometer it is possible only to measure the radii of spherical surfaces. Cylindrometer can measure the radii of curvature of a cylindrical surfaces in addition to the spherical surfaces. In both the spherometer and the cylindrometer one has to necessarily assume the surface to be either spherical or cylindrical respectively. In the case of the quadratic surface from the other. The nomenclature quadricmeter originates from the word quadrics used for quadratic surfaces and was preferred over conicoidmeter.

Appendix A. Ball-Spherometer

In order to ensure higher accuracy, the spherometer is required to have sharper legs. This is sure to harm the surfaces under study. This is more true, when the surfaces are large (as in the telescope mirrors) and the required spherometers are bound to be heavy. One of the most widely used methods to handle this situation is to replace the sharp tips of the three legs of the spherometer with balls of radius r_0 . The resulting spherometer is called a *ball-spherometer* and the basic relation in (4) for the radius of curvature is modified to

$$R(h) = \frac{r^2}{2h} + \frac{h}{2} \pm r_0, \qquad (A.1)$$

where the positive and negative signs are for the convex and concave surfaces respectively [5]. The idea of replacing the sharper tips with balls has been extended to the cylindrometer. The author of this article strongly advocates to use the *ball-cylindrometer* resulting from this replacement.



Figure 5: The Ball-Spherometer fabricated by the author.

Appendix B. Ring-Spherometer

Large mirrors arise in the telescopes requiring larger spherometers, which are bound to be heavy. A possible solution is to replace the tripod legs with a continuous ring. The resulting device is called a *ring-spherometer* [62]. If r is the radius of the ring, then the radius, R of the spherical surface is

$$R(h) = \frac{r^2}{2h} + \frac{h}{2}.$$
 (B.1)

Ring-spherometers provide an average curvature of the surface. The local structure of the same surface is obtained by using the regular spherometers of smaller sizes. In order to ensure accuracy the ring need to be fairly sharp. A finer calculation requires us to use the internal and external radii of the ring for convex and concave surfaces respectively.



Figure 6: The Ring-Spherometer fabricated by the author.

In principle, one can use any regular polygon inscribed in the circle of radius, r. The side L of a regular n-sided polygon is related to the radius r of the circumcircle by the relation $r = L/2\sin(\pi/n)$. This leads to

$$R(h) = \frac{L^2}{8h\sin^2(\pi/n)} + \frac{h}{2}.$$
 (B.2)

Appendix C. Cylindrometer

The cylindrometer is an old idea but seldom mentioned in the introductory laboratory courses. Reference to it can be traced back to an article

published in 1924; but the design presented in it lacked accuracy [43]. An ideal cylindrometer has a square framework supported on four fixed legs of equal lengths. The tips of the four legs lie on the corners of the square. An accurately cut micrometer-screw, passes through the nut fixed at the centroid of the square (point where the two diagonals of the square intersect). The screw is parallel to the four fixed legs. A large circular disc with typically a hundred divisions is attached to the top of the screw. A small millimetre scale is vertically attached to the square framework (parallel to the axis of the screw). The two scales together (working on the principle of the screw gauge) provide the relative height of the screw (known as *sagitta*) with respect to the tips of the four fixed legs. The radius of curvature, R of the cylindrical (and spherical) surface is related to the side of the square L and the height of the micrometer-screw h by geometric relations, which we shall derive.

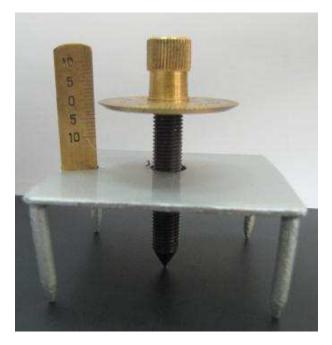


Figure 7: The Cylindrometer fabricated by the author.

The cylindrometer, when used on a spherical surface, the underlying geometry is a circle with the square inscribed in it; the great circle (whose radius is R) touches the tip of the screw of height h, measured relative to the plane containing the tips of the four fixed legs. When the cylindrometer is placed on a cylindrical surface, the two opposite sides of the square base get aligned parallel to the axis of the cylinder; consequently the tips of two legs lie on the circle defining the cylinder and the height h of the screw is measured relative to the plane containing the tips of these four legs.

For the cylinder, r is related to the side, L of the square by the relation, r = L/2, and we obtain

$$R_{\text{cylinder}} = \frac{L^2}{8h} + \frac{h}{2}.$$
 (C.1)

For the sphere, $r = L/\sqrt{2}$, leading to

$$R_{\rm sphere} = \frac{L^2}{4h} + \frac{h}{2} \,. \tag{C.2}$$

The above relations are structurally similar to the formula in Equation (5) for a common spherometer with the tripod base. For a given instrument, the smallest measurable radius of curvature for a cylinder and sphere are $R_{\text{cylinder}}^{\min} = L/2$ and $R_{\text{sphere}}^{\min} = L/\sqrt{2}$ respectively. The largest radius of curvature is constrained by the least count of the micrometer-screw (0.01mm or better). The side L of the cylindrometer is several centimetres or more depending on the size of surface to be studied. The size of a cylindrometer depends on the application. To measure just the sagitta at the centre of a mirror, one requires a cylindrometer with a base almost as big as the mirror itself. Using a smaller base one can move around the cylindrometer to detect local high and low spots produced during the fabrication.

The design of the cylindrometer with a square base was patented in 1972 by Gur Iqbal Singh Hunjan, with the title, *Cylindro-Spherometer* (see [44] for complete specifications). The other name of the device is *Sphero-Cylindrometer*. It is very surprising that the cylindrometer is neither mentioned in the introductory books and nor it is available from the scientific instruments companies. Cylindrometers fabricated in-house are used in many laboratories world-wide [63].

The cylindrometer too has the issue of the sharper legs damaging the surfaces under study. It is straightforward to replace the tips of the sharp legs with balls of radius r_0 . The resulting device is called as the *ball-cylindrometer* (see Figure-8) in analogy with the *ball-spherometer*. It works on both cylindrical and spherical surfaces. The corresponding radii of curvature are given



Figure 8: The Ball-Cylindrometer fabricated by the author.

by

$$R_{\text{cylinder}} = \frac{L^2}{8h} + \frac{h}{2} \pm r_0,$$

$$R_{\text{sphere}} = \frac{L^2}{4h} + \frac{h}{2} \pm r_0,$$
(C.3)

where the positive and negative signs are for the convex and concave surfaces respectively.

Appendix D. Aspherical Surfaces

One often needs to quantify aspherical surfaces, such as the parabolic mirrors. The traditional spherometers can be used to a certain extent for this

purpose. Many aspheric surfaces can be approximated as conic sections of revolution. Conic sections are generally easier to test than a general asphere, because there are geometric null tests for conics [7]. Incorporating the conic constant $K = -e^2$, where e is the eccentricity of the conic section, the basic equation (4) modifies to

$$z(r) = \frac{r^2}{R + \sqrt{R^2 - (K+1)r^2}}.$$
 (D.1)

In this equation z(r) = h(r) is the surface height, $r = \sqrt{(x^2 + y^2)}$ is the radial position and R is the radius of curvature. The types of conic surfaces, determined by the conic constant $K = -e^2$, are as follows

K < -1	Hyperboloid
K = -1	Paraboloid
-1 < K < 0	Prolate Ellipsoid (rotated about its major axis)
K = 0	Sphere
K > 0	Oblate Ellipsoid (rotated about its minor axis)
	Table-1: Types of Conic Surfaces

A series expansion of equation (D.1) can be used to calculate the aspheric departure [11]. If the location of the vertex is known, then a pair of readings using two ring-spherometers of different sizes, close to the vertex can be useful in assessing such surfaces. However, such a procedure would require lot of skill.

Appendix E. Quadratic Surfaces

Many a time one is dealing with aspherical surfaces (non-spherical surfaces). For instance one may be dealing with cylindrical lenses or paraboloidal reflectors [13]. The study of elliptic and hyperbolic mirrors dates back to the time of Greeks [14] and the medieval Arabs [15]-[35]. In telescopes and other optical instruments, the mirrors and lenses generally have a shape coming

from quadratic surfaces [4, 5]. One also finds them in aerodynamic modeling. Such situations, involving aspherical surfaces are very common across almost all scientific disciplines. Quadratic surfaces (also known as quadrics and conicoids) include a wide range of commonly encountered surfaces including, cone, cylinder, ellipsoid, elliptic cone, elliptic cylinder, elliptic hyperboloid, elliptic paraboloid, hyperbolic cylinder, hyperbolic paraboloid, paraboloid, sphere, and spheroid [51]. From the aforementioned list it is evident that one comes across the quadratic surfaces in various areas of science and engineering. Quadratic surfaces have been a basic primitive in computer graphics for a long time and their properties and techniques for visualization are very well researched. Quadratic surfaces are important in geometric modeling. Modeling of three dimensional objects with quadratic surface patches is very effective. Complicated surfaces can be approximated as patches of quadratic surfaces. In this appendix, we shall describe the algebraic classification of the quadratic surfaces into the seventeen standard-form types along with their corresponding equations. We shall also state the conditions under which a given quadric is a quadratic surface of revolution.

E.1.1 Classification of Quadratic Surfaces

A quadratic surface is described by the general second-order equation

$$ax^{2} + by^{2} + cz^{2} + 2fyz + 2gzx + 2hxy + 2px + 2qy + 2rz + d = 0.$$
 (E.1)

Equation (E.1) has ten constants of which one is redundant since the equation can be divided by any one of the constants leading to nine independent constants. Plane sections of a quadratic surface are conic sections namely ellipse, parabola and hyperbola (see [49, 50] for details). Quadratic surfaces have been fully classified and there are 17 standard-form types [51]. These are enumerated in Table-1. Higher order surfaces have been studied extensively. Cubic surfaces are algebraic surface of order three and have been fully classified. However, quartic surfaces and higher order surfaces have not been fully classified [51, 52].

In order to classify the quadratic surfaces, following the notation in [51], we define

$$e = \begin{bmatrix} a & h & g \\ h & b & f \\ g & f & c \end{bmatrix}$$

$$E = \begin{bmatrix} a & h & g & p \\ h & b & f & q \\ g & f & c & r \\ p & q & r & d \end{bmatrix}$$

$$\rho_3 = rank(e)$$

$$\rho_4 = rank(E)$$

$$\Delta = det(E).$$
(E.2)

Let k_1 , k_2 and k_3 be the eigenvalues (characteristic roots) of the matrix e, that is the roots of the characteristic equation

$$\begin{vmatrix} a-x & h & g\\ h & b-x & f\\ g & f & c-x \end{vmatrix} = 0.$$
 (E.3)

We further define

$$k = \begin{cases} 1 & \text{if the signs of the nonzero } k \text{s are the same,} \\ 0 & \text{otherwise.} \end{cases}$$
(E.4)

Using the above defined quantities the seventeen quadrics and their equations in reduced form, are listed in Table-2. It is to be noted that sphere is not separately listed as it is a special case of the ellipsoid (a = b = c). Likewise, the right-circular cone (special case of the elliptic cone, a = b) and the rightcircular cylinder (special case of the elliptic cylinder, a = b) are also not listed separately. Any quadratic surface described by the general equation (E.1) can be transformed to one of the seventeen standard-form types using translations and rotations of the coordinate axes.

S. No.	Surafce	Equations	Conditions			
			$ ho_3$	ρ_4	$\operatorname{sign}(\Delta)$	k
1	Coincident Planes	$x^2 = 0$	1	1		
2	Ellipsoid (Imaginary)	$\frac{x^2}{a^2} + \frac{y^2}{b^2} + \frac{z^2}{c^2} = -1$	3	4	+	1
3	Ellipsoid (Real)	$\frac{\frac{d^2}{a^2} + \frac{b^2}{b^2} + \frac{c^2}{c^2}}{\frac{z^2}{c^2}} = 1$	3	4	_	1
4	Elliptic Cone (Imaginary)	$\frac{x^2}{a^2} + \frac{y^2}{b^2} + \frac{z^2}{c^2} = 0$	3	3		1
5	Elliptic Cone (Real)	$\frac{x^2}{a^2} + \frac{y^2}{b^2} = z^2$	3	3		0
6	Elliptic Cylinder (Imaginary)	$\frac{\frac{x^2}{a^2} + \frac{y^2}{b^2} = -1}{\frac{x^2}{a^2} + \frac{y^2}{b^2} = 1}$ $\frac{\frac{x^2}{a^2} + \frac{y^2}{b^2} = z}{\frac{x^2}{a^2} + \frac{y^2}{b^2} = z}$	2	3		1
7	Elliptic Cylinder (Real)	$\frac{x^2}{a^2} + \frac{y^2}{b^2} = 1$	2	3		1
8	Elliptic Paraboloid	$\frac{x^2}{a^2} + \frac{y^2}{b^2} = z$	2	4	_	1
9	Hyperbolic Cylinder	$\frac{x^2}{a^2} - \frac{y^2}{b^2} = -1$	2	3		0
10	Hyperbolic Paraboloid	$\frac{x^2}{a^2} - \frac{y^2}{b^2} = -z$	2	4	+	0
11	Hyperboloid of one sheet	$\frac{\frac{a}{x^2}}{\frac{a^2}{a^2} + \frac{y^2}{b^2} - \frac{z^2}{c^2} = 1$	3	4	+	0
12	Hyperboloid of two sheets	$\frac{x^2}{a^2} + \frac{y^2}{b^2} - \frac{z^2}{a^2} = -1$	3	4	_	0
13	Intersecting Planes (Imaginary)	$\frac{\frac{x^2}{a^2} + \frac{y^2}{b^2}}{\frac{x^2}{a^2} - \frac{y^2}{b^2}} = 0$	2	2		1
14	Intersecting Planes (Real)	$\frac{x^2}{a^2} - \frac{y^2}{b^2} = 0$	2	2		0
15	Parabolic Cylinder	$x^2 + 2rz = 0$	1	3		
16	Parallel Planes (Imaginary)	$x^2 = -a^2$	1	2		
17	Parallel Planes (Real)	$x^2 = a^2$	1	2		

 Table-2:
 Seventeen
 Standard-Form
 Types of
 Quadrics

In passing, we note that the classification of the quantum mechanical quadratic Hamiltonians into classes with a physically relevant representation has been done. In the context of optics such a classification has been done by enumerating the Hamiltonian orbits [64]-[65]. For a comprehensive account of the Hamiltonian Orbits, see the book in [24].

E.1.2 Quadratic Surfaces of Revolution

Quadratic surfaces of revolution (cones, cylinders, ellipsoids, hyperboloids, paraboloids) are common; for instance the mirrors of telescopes generally have rotational symmetry. A quadric of revolution is determined by at most six points on it. The general equation of the quadratic surfaces is accompanied with certain conditions coming from the rotational symmetry, reducing the number of independent constants to six (or less). For instance the sphere is determined by four points on it; right-circular cone, the right-circular cylin-

der and the paraboloid of revolution are determined by five points each respectively.

Theorem 1 A quadric is a surface of revolution if and only if it has two equal non-zero characteristic roots; i.e., the non-zero eigenvalues of the characteristic equation (E.3) repeat twice.

This theorem translates into following three possible cases:

Case–1: None of the mixed-terms constants, f, g, and h are zero.

If $fgh \neq 0$, then

$$\frac{F}{f} = \frac{G}{g} = \frac{H}{h}, \qquad (E.5)$$

where F, G, and H are the cofactors of f, g, and h in the matrix e (*i.e.*, F = gh - af, G = hf - bg, and H = fg - ch).

Case-2: If fgh = 0, then at least two of the mixed-terms constants, f, g, and h are zero (*i.e.*, two are necessarily zero and the third one need not be zero).

If $f = 0, g = 0, h \neq 0$, then

$$(a-c)(b-c) = h^2$$
. (E.6)

If g = 0, h = 0, $f \neq 0$, then

$$(b-a)(c-a) = f^2$$
. (E.7)

If $f = 0, h = 0, g \neq 0$, then

$$(a-b)(c-b) = g^2$$
. (E.8)

Case–3: When the mixed-terms constants, f, g, and h are all zero.

If f = 0, g = 0, and h = 0, then (a - b)(b - c)(c - a) = 0, $\Rightarrow a = b$ or b = c or c = a. (E.9)

Equations (E.5)-(E.9) summarize the necessary and sufficient conditions imposed on the general equation of second degree to represent a surface of revolution [49]. It is interesting to note that the conditions are expressed in terms of the quadratic constants alone and none of the constants of the linear terms (p, q and r) are used.

Appendix F. Quadricmeter (Abstract of the Patent Application)¹

Abstract

Quadricmeter is the instrument devised to identify (distinguish) and measure the various parameters (axis, foci, latera recta, directrix, etc.,) completely characterizing the important class of surfaces known as the quadratic surfaces. Quadratic surfaces (also known as quadrics) include a wide range of commonly encountered surfaces including, cone, cylinder, ellipsoid, elliptic cone, elliptic cylinder, elliptic hyperboloid, elliptic paraboloid, hyperbolic cylinder, hyperbolic paraboloid, paraboloid, sphere, and spheroid. Quadricmeter is a generalized form of the conventional spherometer and the lesser known cylindrometer (also known as the *Cylindro-Spherometer* and *Sphero-Cylindrometer*). With a conventional spherometer it was possible only to measure the radii of spherical surfaces. Cylindrometer can measure the radii of curvature of a cylindrical surface in addition to the spherical surface. In both the spherometer and the cylindrometer one assumes the surface to be either spherical or cylindrical respectively. In the case of the quadricmeter, there are no such assumptions.

¹This is the abstract of the patent application as it appeared in:

• Sameen Ahmed Khan, Official Journal Quadricmeter, of the Patent Office, Issue No. 43/2008, Part-I, pp. 25296(24 October 2008). Application No.: 2126/MUM/2008 A, International Classification: B69G1/36, Controller General of Patents Designs and Trade Marks, Government of India. http://ipindia.nic.in/ipr/patent/journal_archieve/journal_2008/patent_journal_2008 http://ipindia.nic.in/ipr/patent/journal_archieve/journal_2008/pat_arch_102008/or http://www.ipindia.nic.in/, (patent inprocess. http://SameenAhmedKhan.webs.com/quadricmeter.html).

See the references [60, 61] for details and updates.

Appendix G. Optical Techniques

Apart from the contact techniques, it is also possible to use the optical techniques. The major source of inaccuracy in using a spherometer (and its variants describes in this article) is in determining the exact point of contact between the probe and the surface being tested. Sharper legs of the spherometer can damage the surface and this can be circumvented to a good extent by the use of the ball-spherometer (and the ball-cylindrometer suggested by the author in this note). This necessitates the creation of non-contact methods.

Optical techniques based on the interference patterns provide one such means of non- contact procedure to study the surfaces [63]. In some spherometers the point of contact is determined by observing the Newton's ring interference pattern formed between the test surface and an optical surface mounted on the end of the probe. As the probe is brought up to the surface, the ring pattern expands, but when the point of contact is reached, no further motion occurs. Interferometry is a precise and non-destructive tool and determines other optical parameters (such as thickness, refractive index) in addition to the radius of curvature. Interferometer are also used for measuring surface flatness of plano optical elements such as mirrors, prisms and windows.

A Fizeau interferometer can also be used to measure radius of curvature of a surface. A surface having a long radius of curvature can be compared interferometrically with a flat surface to yield Newton's rings. The Fizeau interferometer is the most commonly used interferometer for testing optical components and systems used aboard space borne or space-related instrumentation.

Non-contacting and whole-field method of measuring curvatures using a moving laser source and an image-shearing camera have been also developed. There are also procedures for the surface reconstruction based on the transmitted wavefront. The reconstructed surface is a complete surface including its radius of curvature [66, 67].

Appendix H. Radius of Curvature

Curvature is the amount by which a geometric object deviates from being flat, or straight in the case of a line [68, 69]. The curvature κ of a circle is defined as the reciprocal of its radius R. Smaller circles bend more sharply, and hence have higher curvature. The circles and spheres are unique as they have a constant curvature. The curvature of a smooth curve is defined as the curvature of its osculating circle at each point. Let y = f(x), then the radius of curvature is given by

$$R = \frac{\left[1 + \left(\frac{dy}{dx}\right)^2\right]^{3/2}}{\left|\frac{d^2y}{dx^2}\right|}.$$
 (H.1)

For example, in an ellipse with major axis 2a and minor axis 2b, the vertices on the major axis have the smallest radius of curvature of any points $R = b^2/a$ and the vertices on the minor axis have the largest radius of curvature of any points $R = a^2/b$.

If the curve is given parametrically by the functions x(t) and y(t), then the radius of curvature is

$$R = \frac{\left[\dot{x}^2 + \dot{y}^2\right]^{3/2}}{|\dot{x}\ddot{y} - \dot{y}\ddot{x}|},$$
 (H.2)

where $\dot{x} = dx/dt$, $\ddot{x} = d^2x/dt^2$, $\dot{y} = dy/dt$ and $\ddot{y} = d^2x/dt^2$.

References

- J. N. Jaiswal, *Practical Physics*, (Laxmi Publications, New Delhi, India, 2006). http://www.laxmipublications.com/.
- [2] A. A. Rama Krishna and V. Satyanarayana, *Practical Physics*, (Vikram Publishers, Hyderabad, India, 2005).
- [3] Allan Mackintosh (Editor), Advanced Telescope Making Techniques, (Willmann-Bell, Inc., Virginia, USA, 1986). http://www.willbell.com/.

- [4] Daniel Malacara and Brian J. Thompson (*Editors*), *Handbook of Optical Engineering*, (Marcel Dekker Inc., New York, USA, 2001).
- [5] Hank H. Karow, Fabrication Methods for Precision Optics, (Wiley Series in Pure and Applied Optics), (John Wiley & Sons, 2004). http://eu.wiley.com/.
- [6] E. J. Tew, Jr., Measurement Techniques Used in the Optics Workshop, Applied Optics, 5, 695-700 (1966). Digital Object Identifier (DOI): http://dx.doi.org/10.1364/A0.5.000695.
- [7] D. E. Stoltzmann and P. Ceravolo, Ross null test for conic mirrors, *Applied Optics*, 32, 1189-1199 (1993). Digital Object Identifier (DOI): http://dx.doi.org/10.1364/A0.32.001189.
- [8] Sameen Ahmed Khan, *Lecture Notes in Physics*, Salalah College of Technology E-Learning Website, http://www.sct.edu.om/ (2010).
- [9] Sameen Ahmed Khan, Physics Laboratory Manual, Salalah College of Technology E-Learning Website, http://www.sct.edu.om/ (2010).
- [10] Robert Bud Deborah Jean Warner, and Instruments of Science: AnHistorical Encyclopedia, Tavlor & Fran-York, New US, pp. 569,1998.Digital Object Idencis, (DOI): http://dx.doi.org/10.1007/s00897990278a. tifier http://www.taylorandfrancis.com/.
- [11] David Anderson and Jim Burge, Optical Fabrication, in Handbook of Optical Engineering, (Editors: Daniel Malacara and Brian J. Thompson), Marcel Dekker, New York, USA, Chapter 28, pp. 915-955 (2001).
- [12] S. K. Trikha and A. S. Bhatia, General Formula for Radius of Curvature of a Spherical Surface with a Spherometer, American Journal of Physics, 26(3), 193 (1958). Digital Object Identifier (DOI): http://dx.doi.org/10.1119/1.1934619.
- [13] Ajoy Ghatak, *Optics*, (Tata McGraw-Hill, Delhi, India, 1988). http://www.tmhshop.com/.
- [14] Eugene Hecht, *Optics*, (Addison-Wesley, 1990). http://www.pearsoned.co.uk/Imprints/Addison-Wesley/.

- [15] Roshdi Rashed, A Pioneer in Anaclastics Ibn Sahl on Burning Mirrors and Lenses, ISIS, 81 464-491 (1990), The University of Chicago Press. http://www.jstor.org/stable/233423 and http://press.uchicago.edu/ucp/journals/journal/isis.html
- [16] Roshdi Rashed, Géométrie et Dioptrique au X^e siècle: Ibn Sahl, al-Quhî et Ibn al-Haytham, Collection Sciences et Philosophie Arabes, Textes et Études, Les Belles Lettres, Paris, France (1993). http://www.lesbelleslettres.com/.
- [17] Roshdi Rashed, A Polymath in the 10th Century, Science, 297, 773 (2 August 2002). Digital Object Identifier (DOI): http://dx.doi.org/10.1126/science.1074591.
- [18] David C. Lindleberg, Medieval Islamic Achievement in Optics, Optics & Photonics News (OPN), 14(7), 30-35 (July 2003). Digital Object Identifier (DOI): http://dx.doi.org/10.1364/OPN.14.7.000030. http://www.osa-opn.org/.
- [19] Akhlesh Lakhtakia, Optics in Medieval Islam, Optics & Photonics News (OPN), 14(9), 6 (September 2003). http://www.osa-opn.org/.
- [20] Abdus Salam, in *Ideals and Realities*, (C. H. Lai and A. Kidwai, eds.), 3rd ed., World Scientific, Singapore, pp. 283 (1989). http://www.worldscientific.com/worldscibooks/10.1142/0988.
- [21] Abdus Salam. Sciences in Renaissance of inIslamic Countries. (H. **R**. Dalafi and М. Η. А. Haseds.), World Scientific, Singapore, 31san, pp. (1994).http://www.worldscientific.com/worldscibooks/10.1142/0884.
- [22] Zakaria Virk, Europe's Debt to the Islamic World, Review of Religions, 98(07), 36-52 (July 2003). http://www.reviewofreligions.org/download/RR200307.pdf#page=36.
- [23] K. B. Wolf and G. Krotzsch. Geometry and dynamics in refracting systems, European Journal of Physics, 16(1), 14-20 (January 1995). Digital Object Identifier (DOI): http://dx.doi.org/10.1088/0143-0807/16/1/003.

- [24] K. B. Wolf, Geometric Optics on Phase Space, pp. 57-58 (Springer, 2004). http://www.springer.com/physics/optics+%26+lasers/book/978-3-540-220
- [25] M. Salih, M. Al-Amri and M. El-Gomati, The Miracle of Light, A World of Science, 3(4), 2-7 (October-December 2005). http://www.unesco.org/science/infocus_full_oct_05.shtml.
- [26] M. Salih, M. Al-Amri and M. El-Gomati, The Miracle of Light, Natural Science Quarterly Newsletter, UNESCO; Publication No. 385 (2006), (Foundation for Science Technology and Civilization, http://www.fstc.org.uk/).
- [27] Sameen Ahmed Khan, Medieval Arab Understanding of the Rainbow Formation, Europhysics News, 37(3), 10 (May/June 2006). (Publication of the European Physical Society). http://www.europhysicsnews.org/.
- [28] Sameen Ahmed Khan, Science Historian Roshdi Hifni Rashed Awarded the King Faisal International Prize for 2007, Europhysics News, 38(2), 7 (March-April 2007). (Publication of the European Physical Society). http://www.europhysicsnews.org/. Website of the King Faisal Foundation: http://www.kff.com/.
- [29] Sameen Ahmed Khan, Science Historian Roshdi Hifni Rashed Awarded the King Faisal International Prize for 2007, AAPPS Bulletin, 17(4), 37 (August 2007). (AAPPS: Association of Asia Pacific Physical Societies). http://www.aapps.org/.
- [30] Sameen Ahmed Khan, Sophisticated Geometry in Islamic Architecture, Radiance Viewsweekly, Vol. XLV, No. 3, pp. 7 (22-28 July 2007). http://www.radianceweekly.com/
- [31] Sameen Ahmed Khan, Penrose Geometry Evokes New Interest, Islamic Voice, Vol. 20-12 No. 252, pp. ?? (December 2007). http://islamicvoice.com/.
- [32] Sameen Ahmed Khan, What is Mathematics?, Youth Observer, pp. 14 (October 2006 Ramadhan 1427 AH). Supplement to Oman Observer, Vol. 25, No. 327, (Saturday the 07 October 2006). (OEPNPA: Oman Establishment for Press, News, Publication

and Advertising in co-operation with the Ministry of Education). http://www.omanobserver.com/.

- [33] Sameen Ahmed Khan, Physics, Youth Observer, pp. 14 (January 2007 Dhul Hijjah 1427 AH). Supplement to Oman Observer, Vol. 26, No. 63 (Tuesday the 16 January 2007). (OEPNPA: Oman Establishment for Press, News, Publication and Advertising in co-operation with the Ministry of Education). http://www.omanobserver.com/.
- [34] Sameen Ahmed Khan, Chemistry, Youth Observer, pp. 13 (May 2007
 Rabee Al Thani 1428 AH). Supplement to Oman Observer, Vol. 26, No. 174 (Monday the 07 May 2007). (OEPNPA: Oman Establishment for Press, News, Publication and Advertising in co-operation with the Ministry of Education). http://www.omanobserver.com/.
- [35] Sameen Ahmed Khan, Arab Origins of the Discovery of the Refraction of Light; Roshdi Hifni Rashed Awarded the 2007 King Faisal International Prize, Optics & Photonics News (OPN), 18(10), 22-23 (October 2007). http://www.osa-opn.org/ and http://www.kff.com/.
- [36] D. Ambrosini, A. Ponticiello, G. Schirripa Spagnolo, R. Borghi and F. Gori, Bouncing light beams and the Hamiltonian analogy, European Journal of Physics 18, 284-289 (1997). Digital Object Identifier (DOI): http://dx.doi.org/10.1088/0143-0807/18/4/008.
- [37] P. W. Hawkes and E. Kasper, *Principles of Electron Optics*, vols. I and II, (Academic Press, London 1989); P.W. Hawkes, E. Kasper, *Principles of Electron Optics*, vol. 3, *Wave Optics*, (Academic Press, London and San Diego 1994).
- [38] M. Born and E. Wolf, *Principles of Optics*, (Cambridge University Press, United Kingdom, 1999). http://www.cambridge.org/.
- [39] G. W. Forbes, Hamilton's **Optics:** Characterizing Ray Mapping and Opening a Link to Waves, Optics & Photonics News, 12(11),34-38 (2001).Digital Object Identihttp://dx.doi.org/10.1364/OPN.12.11.000034. fier (DOI): http://www.osa-opn.org/.

- [40] Sameen Ahmed Khan, Analogies between light opcharged-particle Beam tics and optics, ICFA Dy-Newsletter, 27,42 - 48(June 2002).(ICFA: namics pp. International Committee for Future Accelerators). *E*-Print: http://arXiv.org/abs/physics/0210028/ (2002).http://icfa-usa.jlab.org/archive/newsletter/icfa_bd_nl_27.pdf.
- Ahmed Khan, The Foldy-Wouthuysen [41] Sameen Transformation Technique \mathbf{in} **Optics**, Optik, 117(10)(2006)481-488. http://www.elsevier-deutschland.de/ijleo/, http://dx.doi.org/10.1016/j.ijleo.2005.11.010.
- [42] Sameen Ahmed Khan, The Foldy-Wouthuysen Transformation Technique in Optics, in: P. W. Hawkes (Ed.), Advances in Imaging and Electron Physics, Vol. 152, Elsevier, Amsterdam, (2008) pp. 49-78 (ISBN-10: 0123742196 and ISBN-13: 978-0-12-374219-3). http://dx.doi.org/10.1016/S1076-5670(08)00602-2.
- [43] H. S. Rowell, A Modified Spherometer, Journal of Scientific Instruments, 2, 17-20 (1924). Digital Object Identifier (DOI): http://dx.doi.org/10.1088/0950-7671/2/1/304.
- [44] Gur Iqbal Singh Hunjan, Cylindro-Spherometer, Patent Number 136983 (Filed in December-1972, Granted in April-1975), Patent Office, Government of India. Complete design available at the Patent Office Website: http://www.ipindia.nic.in/.
- [45] Sameen Ahmed Khan, Cylindrometer, The Physics Teacher, 48(9), 607 (December 2010). (AAPT: American Association of Physics Teachers). Digital Object Identifier (DOI): http://dx.doi.org/10.1119/1.3517029. http://www.aapt.org/.
- [46] Sameen Ahmed Khan, Cylindro-Spherometer, Bulletin of the IAPT, 26(1), 4-6 (January 2009). (IAPT: Indian Association of Physics Teachers). http://indapt.org/ and http://www.iapt.org.in/.
- Coordinate [47] Sameen Ahmed Khan, Geometric Approach Bulletin of the IAPT, 139-142 (June to Spherometer, 5(6),(IAPT: 2013). Indian Association of Physics Teachers).

http://indapt.org/ and http://www.iapt.org.in/. *E-Print* arXiv: http://arxiv.org/abs/1309.1951/.

- [48] Sameen Ahmed Khan, Quadratic Surfaces in Science and Engineering, Bulletin of the IAPT, Volume 2(11), 327-330 (November 2010). (IAPT: Indian Association of Physics Teachers). http://indapt.org/ and http://www.iapt.org.in/.
- [49] Shanti Narayan and P. K. Mittal, Analytical Solid Geometry, (S Chand & Company Ltd., Delhi, India, 2007). http://www.schandgroup.com/.
- [50] Arnold Dresden, Solid Analytical Geometry and Determinants, (Dover Publications, 1965). http://store.doverpublications.com/.
- [51] Eric W. Weisstein, CRC Concise Encyclopedia of Mathematics, (CRC Press, Taylor and Francis, 2003). http://www.crcnetbase.com/isbn/9781584883470.
- [52] Additional technical details, historical accounts and references can be had from Eric W. Weisstein, *From MathWorld-A Wolfram Web Resource*, http://mathworld.wolfram.com/.
- [53] *Microsoft EXCEL*, http://www.microsoft.com/office/excel/.
- [54] Fathiya Khamis Al Rawahi, Sameen Ahmed Khan and Abdul Huq, Microsoft Excel in the Mathematics Classroom: A Case Study, in *Proceedings* of The Second Annual Conference for Middle East Teachers of Mathematics, Science and Computing (METSMaC 2006), The Petroleum Institute, Abu Dhabi, United Arab Emirates, 14-16 March 2006. *Editors*: Seán M. Stewart, Janet E. Olearski and Douglas Thompson, pp. 131-134 (2006). http://www.metsmac.org/2007/proceedings/2006/Khan-S-METSMaC-2006.pdf.
- [55] Sameen Ahmed Khan, Spreadsheets in Science and Education, Youth Observer, pp. 10 (March 2007 - Safar 1428 AH). Supplement to Oman Observer, Vol. 26, No. 116 (Saturday the 10 March 2007). (OEPNPA: Oman Establishment for Press, News, Publication and Advertising in co-operation with the Ministry of Education). http://www.omanobserver.com/.

- [56] Sameen Ahmed Khan, Microsoft Excel in the Physics Classroom, in Proceedings of The Third Annual Conference for Middle East Teachers of Mathematics, Science and Computing (METSMaC 2007), The Petroleum Institute, Abu Dhabi, United Arab Emirates, 17-19 March 2007. Editors: Seán M. Stewart, Janet E. Olearski, Peter Rodgers, Douglas Thompson and Emer A. Hayes, pp. 171-175 (2007). http://www.metsmac.org/2007/proceedings/2007/Khan-METSMaC-2007.pdf.
- [57] Sameen Ahmed Khan, Data Analysis Using Microsoft Excel in the Physics Laboratory, Bulletin of the IAPT, 24(6), 184-186 (June 2007). (IAPT: Indian Association of Physics Teachers). http://indapt.org/ and http://www.iapt.org.in/.
- [58] *MATHEMATICA* is a registered trademark of the Wolfgang Research, Inc. http://www.wolfram.com/.
- [59] Nino Boccara, Essentials of Mathematica with Applications to Mathematics and Physics, Springer, (2007). http://www.springer.com/physics/theoretical,+mathematical+%26+computationa
- [60] Sameen Ahmed Khan, Quadricmeter, Official Journal of the Patent Office, Issue No. 43/2008, Part-I, pp. 25296 (24) October 2008). Application No.: 2126/MUM/2008A. International Classification: B69G1/36, Controller General of Patents Designs and Trade Marks, Government of India. http://ipindia.nic.in/ipr/patent/journal_archieve/journal_2008/patent_jour http://ipindia.nic.in/ipr/patent/journal_archieve/journal_2008/pat_arch_10 http://www.ipindia.nic.in/, (patent inprocess, http://SameenAhmedKhan.webs.com/quadricmeter.html).
- [61] Sameen Ahmed Khan, Quadricmeter: the Generalized Spherometer. (*in preparation*). Awaiting the grant of the patent! See [60] for the updates.
- [62] Rajpal S. Sirohi, Wave Optics and its Applications, Orient Longman, India, 1993.
- [63] R. P. Shukla and Dinesh V Udupa, Interferometric Testing of Optical Components: Testing Facilities at the Spectroscopy Division of BARC, BARC Newsletter, 215, 7-13 (Decem-

ber 2001). (**BARC**: Bhabha Atomic Research Centre, Mumbai, India). http://barc.ernet.in/publications/nl/2001/200112.pdf.

- [64] R. Simon, E. C. G. Sudarshan and N. Mukunda, Anisotropic Gaussian Schell-model beams: passage through opassociated tical systems and invariants, Physial Review 31.2419-2434 (1985). Digital Object Identifier (\mathbf{DOI}) : Α. http://link.aps.org/doi/10.1103/PhysRevA.31.2419.
- [65] Sameen Ahmed Khan and Kurt Bernardo Wolf, Hamiltonian orbit structure of the set of paraxial optical systems, Journal of the Optical Society of America A 19(12), 2436-2444 (December 2002). Digital Object Identifier (DOI): http://dx.doi.org/10.1364/JOSAA.19.002436.
- [66] Lars A. Selberg, Radius measurement by interferometry, Optical Engineering, 31(9), 1961-1966 (September 1992). Digital Object Identifier (DOI): http://dx.doi.org/10.1117/12.59905.
- [67] D. G. Abdelsalama, M. S. Shaalana, M. M. Elokerb and Daesuk Kim, Radius of curvature measurement of spherical smooth surfaces by multiple-beam interferometry in reflection, Optics and Lasers in Engineering, 48(6), 643649 (June 2010). Digital Object Identifier (DOI): http://dx.doi.org/10.1016/j.optlaseng.2010.02.007.
- [68] Eric W. Weisstein, **Radius of Curvature**, From MathWorld-A Wolfram Web Resource, http://mathworld.wolfram.com/RadiusofCurvature.html.
- [69] A. Gray, Modern Differential Geometry of Curves and Surfaces with Mathematica, 2nd ed. Boca Raton, FL: CRC Press, 1997. http://www.crcpress.com/.

This figure "ball-cylindrometer.jpg" is available in "jpg" format from:

This figure "ball-spherometer.jpg" is available in "jpg" format from:

This figure "common-spherometer.jpg" is available in "jpg" format from:

This figure "cylindrometer-coordinate-geometry.jpg" is available in "jpg" format from

This figure "cylindrometer.jpg" is available in "jpg" format from:

This figure "ring-spherometer.jpg" is available in "jpg" format from:

This figure "spherometer-coordinate-geometry.jpg" is available in "jpg" format from

This figure "spherometer-euclidean-geometry.jpg" is available in "jpg" format from: