ARTICLE IN PRESS

MLBLUE-10802; No of Pages 3

Materials Letters xxx (2009) xxx-xxx

Contents lists available at ScienceDirect



Materials Letters



journal homepage: www.elsevier.com/locate/matlet

Effect of crystallographic dislocations on the reverse performance of 4H-SiC p–n diodes

³ Feng Zhao *, Mohammad M. Islam, Biplob K. Daas, Tangali S. Sudarshan

Q14 Department of Electrical Engineering, University of South Carolina, Columbia, SC 29208, United States

ARTICLE INFO

Article history: Received 11 August 2009 Accepted 27 October 2009 Available online xxxx Keywords: 4H-SiC

4H-SiC
 Screw dislocation
 Basal plane dislocation
 Threading edge dislocation
 Breakdown voltage
 Leakage current

 $33 \\ 32$

5

6 7

8

9

10

12

14

34 1. Introduction

With the need for new generation compact and low-loss high power electronics capable of operating at extreme conditions, SiC based devices are being investigated extensively due to its outstanding material properties [1]. However, a significant roadblock for the development and commercialization of high power SiC devices is due to the unavailability of high quality epitaxial substrates with low density of defects.

42 The high density of crystallographic defects has been a long-43 standing problem with SiC material. Micropipes are known to significantly affect device characteristics such as leakage current and 44 breakdown voltage in p-n and Schottky diodes [2,3]. Due to 45improvements in crystal-growth technology during the past several 46 years, micropipe density has been significantly reduced and 4-inch 47 48 Zero-Micropipe n-type SiC substrates are currently available [4]. Even though not as detrimental to device performance as micropipes, the 4950adverse impact of other crystallographic defects, especially the screw dislocation, basal plane dislocation, and threading edge dislocation on 51the device performance needs to be investigated. Qualitative studies 5253 show that 4H-SiC p-n diodes and Schottky diodes containing screw dislocations exhibit a high reverse leakage current and low reverse 54breakdown voltage [5,6]. Basal plane dislocations and their influence 55on the forward I-V of p-n diodes and BJTs were also investigated 56 57extensively [7,8]. Threading edge dislocation pairs also compromise the performance of SiC devices and the role of such defects on the 58

0167-577X/\$ - see front matter © 2009 Published by Elsevier B.V. doi:10.1016/j.matlet.2009.10.062

ABSTRACT

A quantitative study was performed to investigate the impact of crystallographic dislocation defects, 21 including screw dislocation, basal plane dislocation, and threading edge dislocation, and their locations in 22 active and JTE region, on the reverse performance of 4H-SiC p-n diodes. It was found that higher leakage 23 current in diodes is associated with basal plane dislocations, while lower breakdown voltage is attributed to 24 screw dislocations. The above influence increases in severity when the dislocation is in the active region than 25 in the JTE region. Furthermore, due to the closed-core nature, the impact of threading edge dislocation on the 26 reverse performance of the p-n diodes is less severe than that of other dislocations although its density is 27 much higher.

© 2009 Published by Elsevier B.V. 29

30

68

reverse leakage currents of 4H-SiC junction barrier Schottky (JBS) 59 diodes were reported [6]. 60

The focus of this work is to correlate the crystallographic 61 dislocations with the reverse performance of 4H-SiC p-n diodes, 62 and quantify the impact of screw dislocation, basal plane dislocation, 63 and threading edge dislocation as well as their locations in active and 64 JTE regions on breakdown voltage and reverse leakage current. This study sets directions for essential improvements in SiC material 66 quality that will result in higher yield of commercial devices. 67

2. Experiment

The n^- epitaxial layer with a thickness of 15 μ m and nitrogen 69 concentration of 5×10^{15} cm⁻³ was grown on a commercial 8 ° off-70 axis n-type 4H-SiC substrate in a hot-wall CVD reactor with 71 precursor's silane (3 sccm) and propane (0.9 sccm) with hydrogen 72as carrier gas at 1600 °C and 300 torr. The wafer was then diced into 73 small pieces with an area of $8 \times 8 \text{ mm}^2$ for diode fabrication. The epi-74 structure and edge termination were designed for 2500 V blocking 75 voltage based on simulation by ATLAS software of Silvaco. The p-type 76 active region with an area of $1 \times 1 \text{ mm}^2$ and the JTE region with a 77 width of 150 µm were formed simultaneously by an aluminum 78 implantation at room temperature followed by an annealing process 79at 1500 °C for 30 min in argon ambient to activate the dopant. A 1 µm-80 thick graphite cap layer was used to protect the sample from surface 81 degradation due to Si evaporation from SiC during annealing. 82 Standard lithography was performed, and Ti/Al/Ti/Ni metal stack for 83 p-type anode contact was deposited by e-beam evaporation and a lift-84 off process. Ni was deposited on the back of the sample for n-type 85 cathode contact. Both n- and p-type ohmic contacts were prepared by 86

Corresponding author. Tel.: +1 803 777 6303; fax: +1 803 777 8045. *E-mail address*: zhaof2@cec.sc.edu (F. Zhao).

ARTICLE IN PRESS

F. Zhao et al. / Materials Letters xxx (2009) xxx-xxx

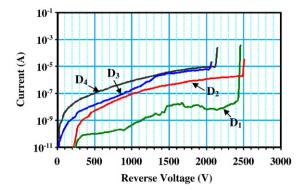


Fig. 1. The reverse I–V characteristics of 4 identical p–n diodes (D_1 – D_4) from different portions on the 4H-SiC sample.

t1.1 Table 1

Threshold breakdown voltage, leakage current, and the number and location of dislocation defects in 4 identical diodes under study.

t1.2 t1.3	Diode V _{BR} (V)		$I_L(\mu A)$	In active region			In JTE region		
t1.4	#	@10 μA	@2000 V	n _{SD}	n _{BPD}	n _{TED}	n _{SD}	n _{BPD}	n _{TED}
t1.5	D ₁	2460	0.007	1	0	110	0	2	47
t1.6	D ₂	2510	1.13	0	0	76	0	7	41
t1.7	D ₃	2070	6.3	5	2	85	0	2	55
t1.8	D_4	2150	8.6	3	2	67	2	7	35

a rapid thermal annealing (RTA) process at 1000 °C for 1 min in high purity nitrogen gas.

Reverse current-voltage characterization was performed using a
 Keithley 2410 voltage source measurement unit in low light condition
 with the current compliance set to 1 mA (0.01 A/cm²). Fluorinert was
 used during high voltage testing over 1000 V to mitigate surface flash-

over. After current–voltage testing, metal contacts were removed and93chemical etching in molten KOH at 600 °C was performed for 3 min to94expose defects present in the sample. A Nomarsky optical microscope95was used to examine the surface of the diodes to identify the type of96defects by etch pit shape recognition and to count the number of97defects present in both the active and JTE region of each diode. Device98performance was then correlated with defects present in the diodes.99

3. Results and discussion

Fig. 1 shows the reverse I–V characteristics on a logarithmic scale 101 of 4 identical p-n diodes (D_1-D_4) from different portions on the SiC 102 sample. Diodes D1 and D2 clearly exhibit higher breakdown voltage 103 and lower leakage current than diodes D3 and D4. The leakage current 104 I_L at the reverse bias of 2000 V and the threshold breakdown voltage 105 V_{BR} corresponding to the leakage current of 10 µA (1×10⁻³ A/cm²) 106 from these 4 diodes were summarized in Table 1. The variation of 107 leakage current and breakdown voltage are directly correlated to the 108 number of crystallographic dislocation defects and their locations in 109the active region and ITE region based on a quantitative study. 110

An optical microscopy image of SiC surface after molten KOH 111 etching is shown in Fig. 2. Inspection of the wafer surface after 112 chemical etching allows identification of the type of dislocations by 113 the characteristics of the etch pits. The hexagonal etch pits correspond 114 to screw dislocations (hollow core) and threading edge dislocations 115 (closed core), while the oval-shaped etch pits correspond to basal 116 plane dislocations. The number of screw dislocations, threading edge 117 dislocations and basal plane dislocations in both the active and JTE 118 regions on each diode was counted carefully and summarized in 119 Table 1, along with the threshold breakdown voltage V_{BR} and leakage 120 current IL. 121

In diodes D_1 and D_2 , there is no basal plane dislocation in the active region and screw dislocation in the JTE region. The breakdown voltage V_{BR} (2460 V) of D_1 is lower than V_{BR} (2510 V) of D_2 due to the 124

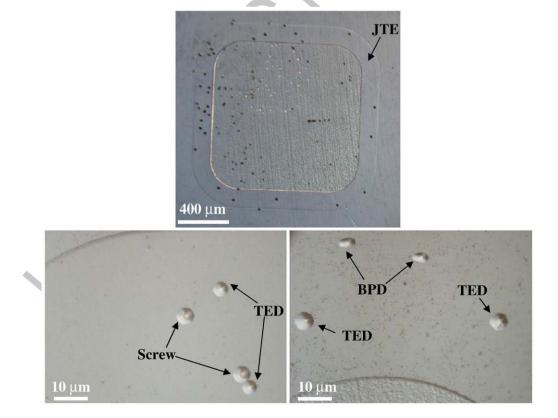


Fig. 2. Optical microscopy image of a 4H-SiC p-n diode after molten KOH etch showing screw dislocation (SD), basal plane dislocation (BPD), and threading edge dislocation (TED).

Please cite this article as: Zhao F, et al, Effect of crystallographic dislocations on the reverse performance of 4H-SiC p-n diodes, Mater Lett (2009), doi:10.1016/j.matlet.2009.10.062

100

ARTICLE IN PRESS

3

> 162 163

4. Conclusion

The impact of screw dislocation, basal plane dislocation, and 164 threading edge dislocation, and their locations in the active and ITE 165 regions, on the reverse performance of 4H-SiC p-n diodes was 166 investigated by a quantitative study. Based on the results and analysis. 167 we conclude that: (1) screw dislocations affect breakdown voltage 168 while basal plane dislocations affect leakage current; (2) basal plane 169dislocations in the active region affect leakage current more than 170 when they are present in the [TE region; (3) screw dislocations in the 171 active region affect breakdown voltage more than when they are 172present in the JTE region; and (4) the effect of threading edge 173 dislocation is much less severe than that of screw dislocation and 174 basal plane dislocation. 175

reported before that threading edge dislocation pair array affects the

blocking capabilities of JBS diodes [6]. To truly investigate the impact

of an individual threading edge dislocation on the diode perfor-

mance, diodes with small areas to only enclose threading edge

dislocation need to be fabricated and characterized.

References

176

180

181

- Shenai K, Scott RS, Baliga BJ. IEEE Trans Electron Devices 1989;36:1811.
 Wahab Q, Ellison A, Henry A, Janzén E, Hallin C, Di Persio J, et al. Appl Phys Lett 2000:76:2725.
- 3] Neudeck P, Powell J. IEEE Electron Device Lett 1994;15:63.
- 4] http://www.cree.com/press/press_detail.asp?i=1179923837641.
- [5] Maximenko S, Soloviev S, Cherednichenko D, Sudarshan T. J Appl Phys 2005;97: 182 013533.
- [6] Grekov A, Zhang QC, Fatima H, Agarwal A, Sudarshan T. Microelectron Reliab 2008;48:1664.
 184
- [7] Muzykov PG, Kennedy RM, Zhang QC, Capell C, Burk A, Agarwal A, et al. Microelectron Reliab 2009;49:32.
 186
- [8] Jacobson H, Bergman JP, Hallin C, Janz'en E, Tuomi T, Lendenmann H. J Appl Phys
 2004;95;1485.
 189

126 number of screw dislocations in the active region of these 4 diodes, $n_{SD2} < n_{SD1} < n_{SD4} < n_{SD3}$, it clearly shows that more screw disloca-127 128 tions result in lower breakdown voltage $V_{BR2} > V_{BR1} > V_{BR4} > V_{BR3}$. There are 7 basal plane dislocations in the ITE region of diode D₂, and 1292 in the JTE region of diode D_1 . Since $V_{BR2} > V_{BR1}$, basal plane 130dislocations have less influence on breakdown voltage, but more 131 basal plane dislocations lead to a higher leakage current of 1.13 µA in 132133 diode D_2 than 0.007 μ A in diode D_1 . There are 5 screw dislocations 134found in the active region of diode D₃, resulting in a much lower breakdown voltage (2070 V) compared to those of diode D_1 and D_2 . 135136The leakage current (6.3 μ A) of D₃ is also higher than those of diode D_1 and D_2 due to the basal plane dislocations in its active region, 137although the number of basal plane dislocation in the JTE region of 138 diode D_3 is 2, not more than those in the JTE region of diode D_1 (2 139 BPDs) and D₂ (7 BPDs). Therefore, we conclude that when basal plane 140 dislocations are in the active region, they affect leakage current more 141 severely than when they exist in the ITE region. Compared to diode 142 D₃ without any screw dislocation found in the ITE region, there are 2 143 screw dislocations in the JTE region of diode D₄. However, the 144 breakdown voltage of diode D₄ is still higher than that of diode D₃, 145 $V_{BR4} > V_{BR3}$, since there are 3 screw dislocations in the active region of 146 147 diode D₄, less than those 5 screw dislocations in the active region of diode D₃. This result shows that when screw dislocations are in the 148 active region, they affect breakdown voltage more than when they 149exist in the ITE region. The number of basal plane dislocations in the 150active region of diode D₃ and D₄ is same, while the leakage current of 151152diode D₄ is higher than that of diode D₃ due to more basal plane dislocations in its JTE region, 7 versus 2. The density of threading edge 153dislocation is much higher than that of screw dislocation and basal 154plane dislocation, as shown in Table 1, but due to its closed-core 155nature, its impact on device reverse performance is much less in 156157severity compared to the other two types of dislocations. It was 190

screw dislocation existing in its active region. When comparing the

125